

Issues


SERVICE BULLETIN No. BB/45

- 1. WITH REFERENCE TO:** Kubicek BB balloons with transparent windows of early design without a tape around the window foil edge (envelope serial numbers: 662, 663, 674, 709, 711, 714)
- 2. REASON:** Possibility of damage to the envelope fabric in contact with window foil.
- 3. REQUIRED ACTION:**
1. Extended procedure of the annual / 100 hour inspection: Inspect all transparent envelope windows along their entire perimeter for a damage of the fabric. In case the fabric is worn from the contact with window foil the entire affected panel is to be replaced.
 2. Insert the Maintenance Manual Supplement into the to folder of balloon documents.
- 4. DEADLINE FOR ACTION:** Next annual / 100 hour inspection
- 5. ACTION CARRIED OUT BY:** Owner / operator
- 6. INDUCED COST COVERED:** Owner / operator
- 7. NECESSARY MATERIAL:** Maintenance Manual Supplement (*doc. no. B.2202-EW, revision 0*)
- 8. PROCESS:** The extension of the annual / 100 hour inspections is described in the above supplement. Download it from the Kubicek Balloons website, print and insert into the folder of balloon documents.s
- 9. BULLETIN TAKES EFFECT:** 30 Apr 2014
- 10. ENCLOSURES:** Distinction of envelope window designs

Technical content of this document is approved under the authority of DOA No. EASA.21J.277.

On behalf of BALÓNY KUBÍČEK spol. s r.o.

Petr Kubíček, technical director

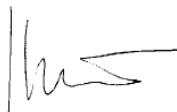


Date: 30 Apr 2014

ENCLOSURE

Distinction of envelope window designs



Window without edge tape - AFFECTED

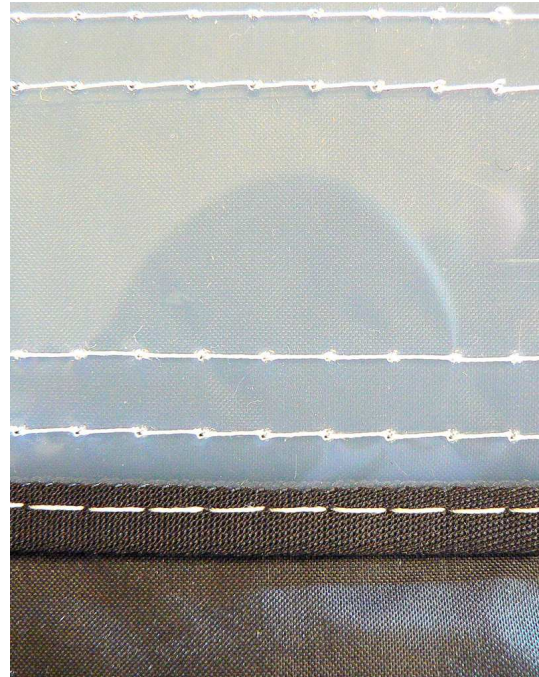

Window with edge tape - NOT AFFECTED